

97-02 DODGE BOX BOARD

IN222 05/02/03

DRILLING INTO BODY AND FRAME IS REQUIRED.

INSTALLATION QTY. DI PARTS LIST: 1 RI

QTY. DESCRIPTION

1 RUNNING BOARD 1 DRIVER & 1 PASSENGER

1 STONE GUARD 1 LEFT & 1 RIGHT

8 3/8"x1 SELF TAPPING SCREW

6 #14x3/4" SHEET METAL SCREW

4 1/4x5/8" SQUARE HEAD SCREW

4 1/4-20 HEX NUT

1 END CAP 1 LEFT & 1 RIGHT

QTY. DESCRIPTION

2 5/16" CLIP NUT

10 5/16"x 3/4" BOLT

8 5/16-18 HEX WASHER HEAD NUT


2 FLAT BRACKET, FL74

2 FLAT BRACKET, FL73 D&P

2 HORIZONTAL BRACKET, SUPPORT, 3124F

2 #14 X 3/4 TEK SCREW

TOOLS REQUIRED: 5/16" DRILL * 1/2" HEX SOCKET * 1/2" WRENCH * 5/16" NUT DRIVER * 3/8" NUT DRIVER

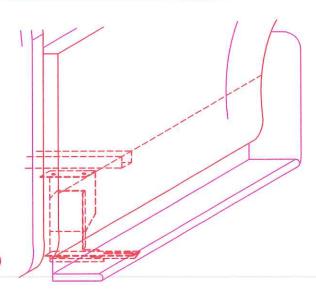


BOX BRACKET LOCATION (DRIVERS SIDE SHOWN)



LOCATE THE FIRST BED CROSS BRACE BEHIND THE CAB



BRACKET ASSEMBLY ASSEMBLE WITH 5/16" BOLTS

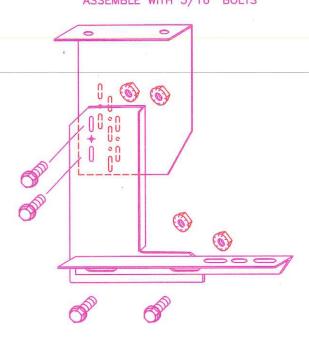



PREDRILL A 5/16" HOLE NEAR THE END OF THE CROSSBRACE SLIDE NUT CUP INTO END OF CROSS BRACE AT BRACKET LOCATION

BRACKET ASSEMBLY MOUNT TO BED ASSEMBLE WITH 5/16" BOLTS AND NUT CUP AND #14 SELF DRILLING SCREW

